


3/8" DRIVE DEEP SOCKETS

► Proto® Sockets are ideal for use on stubborn or damaged fasteners, and also on fasteners made from soft materials.

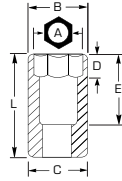

- Radius-corner socket design
- Engages flats for better grip
- Improves the ability to turn worn or rounded fasteners

| INCH | 6 | 12 | 12 | Nut End Outside Diameter (in) (B) | Drive End Outside Diameter (in) (C) | Nut Depth (in) (D) | Bolt Clearance Depth (in) (E) | Overall Length (in) (L) | Weight (lbs) |
|-------|--------|-------|--------|-----------------------------------|-------------------------------------|--------------------|-------------------------------|-------------------------|--------------|
| 1/4 | J5008H | J5008 | - | 13/32 | 21/32 | 5/16 | 1-11/16 | 2-1/8 | 0.10 |
| 5/16 | J5010H | J5010 | - | 15/32 | 21/32 | 13/32 | 1-11/16 | 2-1/8 | 0.10 |
| 11/32 | J5011H | J5011 | - | 1/2 | 21/32 | 25/64 | 1-11/16 | 2-1/8 | 0.09 |
| 3/8 | J5012H | J5012 | J5012B | 35/64 | 21/32 | 13/32 | 1-11/16 | 2-1/8 | 0.10 |
| 7/16 | J5014H | J5014 | J5014B | 21/32 | 21/32 | 7/16 | 1-11/16 | 2-1/8 | 0.12 |
| 1/2 | J5016H | J5016 | J5016B | 23/32 | 23/32 | 33/64 | 1-11/16 | 2-1/8 | 0.14 |
| 9/16 | J5018H | J5018 | J5018B | 51/64 | 51/64 | 19/32 | 1-11/16 | 2-1/8 | 0.18 |
| 5/8 | J5020H | J5020 | J5020B | 7/8 | 7/8 | 43/64 | 2-5/16 | 2-3/4 | 0.24 |
| 11/16 | J5022H | J5022 | J5022B | 15/16 | 15/16 | 43/64 | 2-5/16 | 2-3/4 | 0.30 |
| 3/4 | J5024H | J5024 | J5024B | 1-1/64 | 1-1/64 | 43/64 | 2-5/16 | 2-3/4 | 0.33 |
| 13/16 | J5026H | J5026 | J5026B | 1-5/64 | 1-5/64 | 43/64 | 2-5/16 | 2-3/4 | 0.36 |
| 7/8 | J5028H | J5028 | J5028B | 1-15/64 | 1-15/64 | 1-3/16 | 2-5/16 | 2-3/4 | 0.43 |
| 15/16 | J5030H | J5030 | J5030B | 1-15/64 | 1-15/64 | 1-3/16 | 2-5/16 | 2-3/4 | 0.46 |
| 1 | J5032H | J5032 | J5032B | 1-5/16 | 1-5/16 | 1-3/16 | 2-5/16 | 2-3/4 | 0.54 |

| MM | 6 | 12 | Nut End Outside Diameter (in) (B) | Drive End Outside Diameter (in) (C) | Nut Depth (in) (D) | Bolt Clearance Depth (in) (E) | Overall Length (in) (L) | Weight (lbs) |
|----|---------|--------|-----------------------------------|-------------------------------------|--------------------|-------------------------------|-------------------------|--------------|
| 6 | J5006MH | J5006M | 25/64 | 21/32 | 5/16 | 1-11/16 | 2-1/8 | 0.10 |
| 7 | J5007MH | J5007M | 27/64 | 21/32 | 5/16 | 1-11/16 | 2-1/8 | 0.09 |
| 8 | J5008MH | J5008M | 15/32 | 21/32 | 5/16 | 1-15/16 | 2-1/8 | 0.10 |
| 9 | J5009MH | J5009M | 33/64 | 21/32 | 25/64 | 1-11/16 | 2-1/8 | 0.10 |
| 10 | J5010MH | J5010M | 37/64 | 21/32 | 25/64 | 1-11/16 | 2-1/8 | 0.11 |
| 11 | J5011MH | J5011M | 21/32 | 21/32 | 7/16 | 1-11/16 | 2-1/8 | 0.12 |
| 12 | J5012MH | J5012M | 45/64 | 45/64 | 33/64 | 1-1/2 | 2-1/8 | 0.14 |
| 13 | J5013MH | J5013M | 23/32 | 23/32 | 33/64 | 1-1/2 | 2-1/8 | 0.15 |
| 14 | J5014MH | J5014M | 25/32 | 25/32 | 19/32 | 1-1/2 | 2-1/8 | 0.16 |
| 15 | J5015MH | J5015M | 55/64 | 55/64 | 21/32 | 2-5/16 | 2-3/4 | 0.24 |
| 16 | J5016MH | J5016M | 55/64 | 55/64 | 21/32 | 2-5/16 | 2-3/4 | 0.24 |
| 17 | J5017MH | J5017M | 15/16 | 15/16 | 21/32 | 2-5/16 | 2-3/4 | 0.28 |
| 18 | J5018MH | J5018M | 15/16 | 15/16 | 21/32 | 2-5/16 | 2-3/4 | 0.28 |
| 19 | J5019MH | J5019M | 1-1/64 | 1-1/64 | 11/16 | 2-5/16 | 2-3/4 | 0.33 |
| 20 | J5020MH | J5020M | 1-5/64 | 1-5/64 | 11/16 | 2-5/16 | 2-3/4 | 0.35 |
| 21 | J5021MH | J5021M | 1-5/64 | 1-5/64 | 11/16 | 2-5/16 | 2-3/4 | 0.35 |
| 22 | J5022MH | J5022M | 1-11/64 | 1-11/64 | 11/16 | 2-5/16 | 2-3/4 | 0.46 |
| 23 | J5023MH | J5023M | 1-15/64 | 1-15/64 | 1-3/16 | 2-5/16 | 2-3/4 | 0.55 |
| 24 | J5024MH | - | 1-9/32 | 1-9/32 | 1-3/16 | 2-5/16 | 2-3/4 | 0.56 |
| 25 | J5025MH | - | 1-9/32 | 1-9/32 | 1-3/16 | 2-5/16 | 2-3/4 | 0.56 |
| 26 | J5026MH | J5026M | 1-9/32 | 1-9/32 | 1-3/16 | 2-5/16 | 2-3/4 | 0.65 |

6 6 POINT
8 8 POINT
12 12 POINT
SPL SPLINE
HEX HEX
FULL POLISH
SATIN
BLACK OXIDE
INSULATED