




Precision Drill Chuck Arbors


Morse Taper to Jacobs Taper

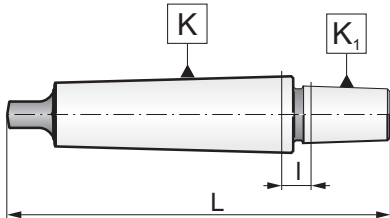

Type 5362

Morse Taper K	Part Number	Chuck Mount K1	L	I	Wt lbs
1	7-052-101	1	3.3	0.2	0.22
	7-052-102	2	3.5		0.15
	7-052-103	3	4.0		0.26
	7-052-106	6	3.7	0.3	0.19
	7-052-133	33			0.18
2	7-052-201	1	4.0	0.3	0.27
	7-052-202	2	4.2		0.31
	7-052-203	3	4.4		0.42
	7-052-206	6	4.2		0.39
	7-052-233	33			0.38
3	7-052-302	2	5.0	0.4	0.63
	7-052-303	3	5.2	0.3	0.82
	7-052-304	4	5.7	0.4	1.03
	7-052-305	5	6.0	0.5	1.40
	7-052-306	6	5.0	0.4	0.66
	7-052-333	33		0.3	0.72
4	7-052-403	3	6.3	0.4	1.43
	7-052-404	4	6.7		1.72
	7-052-405	5	6.9		2.10
	7-052-406	6	6.1	0.5	1.35
	7-052-433	33			1.33
5	7-052-503	3	7.6	0.5	3.36
	7-052-504	4	8.0		3.67
	7-052-505	5	8.2		4.05
	7-052-506	6	7.3		3.30
	7-052-533	33	7.4		

Straight to Jacobs Taper

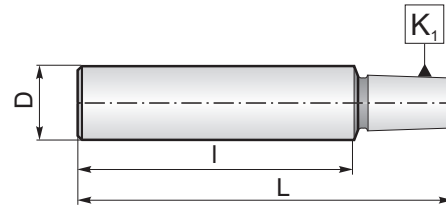

Type 5353

Straight Shank		Part Number	L	Jacobs Taper K1	Wt lbs
D	I				
1/2	2-1/2	7-052-700	3.1	0	0.15
		7-052-701	3.3	1	0.16
		7-052-702	3.5	2	0.20
		7-052-703	3.9	3	0.32
		7-052-7033	3.7	33	0.23
		7-052-706	3.7	6	0.25
5/8	2-1/2	7-052-721	3.3	1	0.25
		7-052-722	3.5	2	0.28
		7-052-723	3.9	3	0.40
		7-052-7233	3.5	33	0.30
		7-052-724	4.3	4	0.68
3/4	3	7-052-742	4.0	2	0.44
		7-052-743	4.3	3	0.55
		7-052-7433	4.1	33	0.47
		7-052-744	4.8	4	0.84
1	3	7-052-746	4.1	6	0.48
		7-052-762	4.1	2	0.75
		7-052-763	4.3	3	0.86
		7-052-7633	4.2	33	0.77
		7-052-764	4.8	4	1.13
		7-052-766	4.2	6	0.80

Morse Taper to Threaded Mount

Type 7470

Morse Taper K	Part Number	Thread G	L	L1	L2	Wt lbs
2	7-052-610	3/8-24	3.7	.6	.197	.26
	7-052-613	1/2-20	4.0	.6	.472	.33
	7-052-616	5/8-16	4.1	.7	.500	.37

