

LOCTITE[®] Nordbak[®] **Brushable Ceramic White**

PRODUCT DESCRIPTION

LOCTITE® Nordbak® Brushable Ceramic White provides the following product characteristics:

following product characteristics.			
Technology	Ероху		
Chemical Type	Ероху		
Appearance (Resin)	white ^{LMS}		
Appearance (Hardener)	Amber ^{LMS}		
Appearance (Mixture)	White liquid		
Components	Two component - requires mixing		
Mix Ratio, by volume - Resin : Hardener	2.8 : 1		
Mix Ratio, by weight - Resin : Hardener	4.5 : 1		
Cure	Room temperature cure		
Application	Coating		
Specific Benefit	Ceramic reinforced		
	Easy to mix and use		
	 Reduces downtime 		
	 Ultra-smooth brushable 		
	consistency		
	High gloss finish		
	 Superior adhesion 		

LOCTITE® Nordbak® Brushable Ceramic White is an ultra smooth, ceramic reinforced epoxy that provides a high gloss, low friction coating designed to protect against turbulence and abrasion under typical dry service temperatures of 29 °C to 93 °C. Used by itself, LOCTITE® Nordbak® Brushable Ceramic White is recommended for sealing and protecting equipment from corrosion and wear. It also works as a top coat over Loctite[®] Nordbak[®] Wearing Compounds for applications requiring surface rebuilding and lasting protection. Typical applications include providing a smooth, protective abrasion resistant coating, repairing heat exchangers and condensers, lining tanks and chutes, resurfacing and repairing rudders and pintel housings, and repairing cooling pump impellers and butterfly valves.

TYPICAL PROPERTIES OF UNCURED MATERIAL

Resin:

Viscosity, Brookfield - RV, 25 °C, mPa·s (cP):

120,000 to 180,000^{LMS} Spindle 7, speed 20 rpm, Weight Per Gallon, lbs/gal

14.8 to 15.6^{LMS}

Hardener:

Viscosity, Brookfield - RV, 25 °C, mPa·s (cP):

Spindle 2, speed 20 rpm, 500 to 1,500^{LMS}

Weight Per Gallon, lbs/gal 8.6 to 8.9^{LMS}

Mixed:

Viscosity, Cone & Plate, 25 °C, mPa·s (cP): Shear rate 10 s⁻¹ 17,000

Coverage 1.1 m² @ 0.5 mm thick/0.9 kg (12 ft² @ 20 mils thick/2 lb)

TYPICAL CURING PERFORMANCE


Curing Properties

Gel Time @ 25 °C, minutes:


400 g mass 35 to 50^{LMS}

Cure Time @ 25 °C, hours Recoat Time @ 25 °C, hours 1 to 3

Working Life

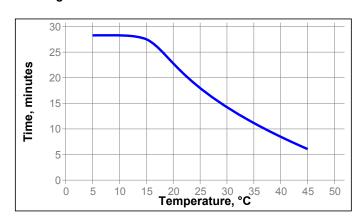

Cure Time

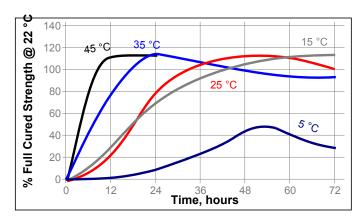



TYPICAL PROPERTIES OF CURED MATERIAL

Cured for 7 days @ 25 °C

Physical Properties:		
Compressive Strength, ISO 604 N/mm² (psi)		74 (10,860)
Compressive Modulus, ISO 604 N/mm² (psi)		4,372 (634,000)
Tensile Strength, ISO 527-2	N/mm² (psi)	30 (4,430)
Tensile Modulus, ISO 527-2	N/mm² (psi)	` '
Flexural strength , at yield, ASTM D790	N/mm² (psi)	62 (9,085)
Flexural Modulus , ASTM D790	N/mm² (psi)	4,627 (670,970)
Elongation, at break, ISO 527-2, %		0.7
Coefficient of Thermal Expansion, ISO 113	359-2 K ⁻¹ :	
Pre Tg		47×10 ⁻⁶
Post Tg		131×10 ⁻⁶
Shore Hardness, ISO 868, Durometer D Glass Transition Temperature, °C:	85	
(Tg) via TMA ISO 11359-2	61	
Volume Shrinkage, ISO 1675, %	4.1	
Water Vapor Transmission Rate, ASTM E9	6:	
Permeance, grams/Pa•s•m²	8.5×10 ⁻¹¹	
Coefficient of Thermal Conductivity, ISO 83 W/(m·K)	0.44	
Abrasion Resistance, ASTM D4060: mg 1 Kg load, CS-10 wheels, Weight of Materia	26	
Heat Deflection Temperature, ASTM D648, °	46	

Electrical Properties:

Volume Resistivity, IEC 60093, Ω⋅cm	1.7×10 ¹⁴
Surface Resistivity, IEC 60093, Ω	6.14×10 ¹⁴

TYPICAL PERFORMANCE OF CURED MATERIAL **Adhesive Properties**

Cured for 72 hours @ 25 °C Lap Shear Strength, ISO 4587: Steel (grit blasted)


N/mm² 19 (2,780)(psi)

TYPICAL ENVIRONMENTAL RESISTANCE

Cured for 72 hours @ 25 °C Lap Shear Strength, ISO 4587: Steel (grit blasted)


Hot Strength

Tested at temperature

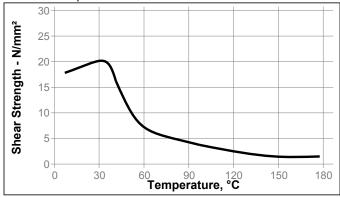

Heat Aging

Aged at temperature indicated and tested @ 22 °C

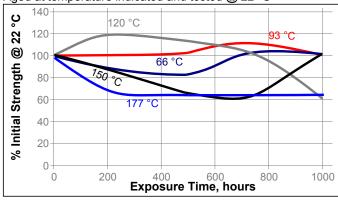

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Material Safety Data Sheet (MSDS).

Directions for use:

Surface Preparation

Proper surface preparation is critical to the long-term performance of this product. The exact requirements vary with the severity of the application, expected service life, and initial substrate conditions.

- 1. Clean, dry and abrade application surface. The more thorough the degree of surface preparation the better the performance of the application. If possible, it is recommended that the surface be grit blasted to a Near White Metal (SSPC-SP10/NACE No. 2) Standard. For less severe applications roughening the surface with hand tools is suitable.
- 2. Solvent cleaning with a residue-free solvent is recommended as the final step to aid in adhesion.

- 1. Material temperature should be between 20 °C to 30 °C.
- 2. Add hardener contents to resin. Mix material vigorously until uniform in color. Be sure to mix along the bottom and sides of mixing container. Mix three to five minutes.

Application Method:

1. Apply fully mixed material to the prepared surface.

Caution: Use an approved, positive-pressure, supplied air respirator when welding or torch cutting near cured compound. Do Not use open flame on compound.

Loctite Material Specification^{LMS}

LMS dated March 30, 2009. Test reports for each batch are available for the indicated properties. LMS test reports include selected QC test parameters considered appropriate to specifications for customer use. Additionally, comprehensive controls are in place to assure product quality and consistency. Special customer specification requirements may be coordinated through Henkel Quality.

Storage

Store product in the unopened container in a dry location. Material removed from containers may be contaminated during use. Do not return liquid to original container. Storage information may be indicated on the product container labeling. Optimal Storage: 8 °C to 21 °C. Storage below 8 °C or greater than 28 °C can adversely affect product properties. Henkel cannot assume responsibility for product which has been contaminated or stored under conditions other than those recommended. If additional information is required, please contact your local Technical Service Center or Customer Service Representative.

Conversions

 $(^{\circ}C \times 1.8) + 32 = ^{\circ}F$ $kV/mm \times 25.4 = V/mil$ mm / 25.4 = inches $\mu m / 25.4 = mil$ $N \times 0.225 = lb$ $N/mm \times 5.71 = lb/in$ $N/mm^2 \times 145 = psi$ $MPa \times 145 = psi$ $N \cdot m \times 8.851 = lb \cdot in$ $N \cdot m \times 0.738 = lb \cdot ft$ $N \cdot mm \times 0.742 = oz \cdot in$ $mPa \cdot s = cP$

Note

The data contained herein are furnished for information only and are believed to be reliable. We cannot assume responsibility for the results obtained by others over whose methods we have no control. It is the user's responsibility to determine suitability for the user's purpose of any production methods mentioned herein and to adopt such precautions as may be advisable for the protection of property and of persons against any hazards that may be involved in the handling and use thereof. In light of the foregoing, Henkel Corporation specifically disclaims all warranties expressed or implied, including warranties of merchantability or fitness for a particular purpose, arising from sale or use of Henkel Corporation's products. Henkel Corporation specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. The discussion herein of various processes or compositions is not to be interpreted as representation that they are free from domination of patents owned by others or as a license under any Henkel Corporation patents that may cover such processes or compositions. We recommend that each prospective user test his proposed application before repetitive use, using this data as a guide. This product may be covered by one or more United States or foreign patents or patent applications.

Trademark usage

Except as otherwise noted, all trademarks in this document are trademarks of Henkel Corporation in the U.S. and elsewhere. [®] denotes a trademark registered in the U.S. Patent and Trademark Office.

Reference 1.3